









# ASSEMBLY INSTRUCTION

## rearTWIST UHD BNC

### 75Ω Cable Connector Crimp version


UHD 4K8K

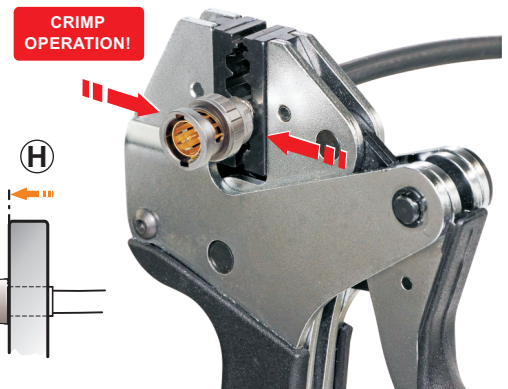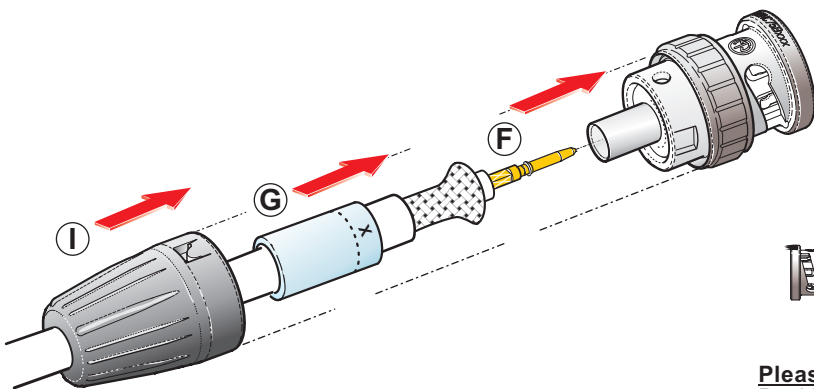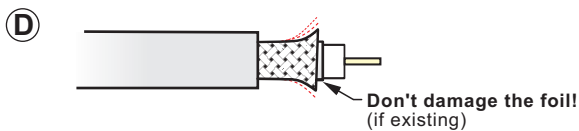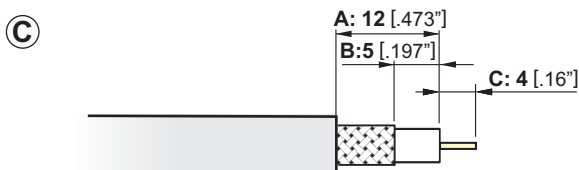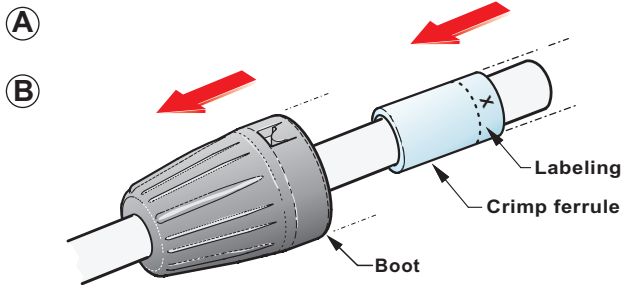

- (A)** Slide the boot onto the cable
  - Position the labeling to the cable end
- (B)** Slide the crimp ferrule onto the cable
- (C)** Prepare cable as shown
  - Use an adjustable coaxial cable stripper
- (D)** Spread the braided shield
  - (It's easily with the NEUTRIK® "SHIELD-SPREADING-TOOL"!)
- (E)** Crimp the pin
  - position the pin on the center conductor
  - Crimp the pin with the tool
    - (For best crimping-results it is recommended to use the original Neutrik crimp tool HX-R-BNC with appropriate crimp die)
  - Straighten the pin if misaligned.
- (F)** Insert the cable into the connector body
- (G)** Slide the crimp ferrule over the shield to the front and push the cable to its end position until you hear a snap noise.

**Please note:**  
Position the connector body  
Flush with the die face.

#### Assembled Connector

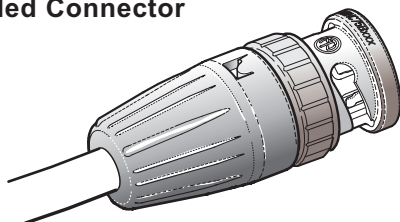

- (H)** Crimp the ferrule with the tool
  - (For best crimping-results it is recommended to use the original Neutrik tool - HX-R-BNC with the corresponding insert)
- (I)** Snap the boot onto the connector body

NEUTRIK AG	LI	T: +423/237 24 24	F: +423/232 53 93	NEUTRIK France	FR	T: +33 1/4131 6750	F: +33 1/4131 0511
NEUTRIK USA Inc.	USA	T: +1 704 / 972 3050	F: +1 704/438 9202	NEUTRIK Tokyo Ltd.	JP	T: +81 3/3663 4733	F: +81 3/3663 4796
NEUTRIK (UK) Ltd.	UK	T: +44 1983 / 811 441	F: +44 1983/811 439	NEUTRIK Hong Kong Ltd.	HK	T: +852/2687 6055	F: +852/2687 6052
NEUTRIK Vertriebs GmbH	DE/NL/AT/DK	T: +49 8131 / 280 890	F: +49 8131/280 830	NEUTRIK India Pvt. Ltd.	IND	T: +91/982 05 43 424	F: +91/22 26163 540

Draft. Nr.: BDA 398 | Update: 15.04.2015 | Data subject to change without prior notice. ©2015 NEUTRIK®. ALL RIGHTS RESERVED. NEUTRIK® are registered trademark.

www.neutrik.com

**NEUTRIK®**